

# Mini Drop-out Candle Stand

## Materials:

Medium Sheet Spectrum Godiva Opal Art (Item #X6755-MD)

Medium Sheet Spectrum White Opal (Item #X200-MD)

Coaster Holder (Item 97309)

1/4" Fiber Paper (Item #92805)


Shelf Paper (Item #7405)

Craft knife (Item#5536)



## Instructions:

1. Create a pattern: Cut a 4" square out of printer paper. Place the coaster holder on top of the square and trace the center square onto the paper. Use scissors or craft knife to cut out the center square.
2. Cut a 4" square out of the white glass and a 4" square out of the Godiva - or art glass of your choice. Clean, dry, stack and full fuse using the schedule provided.

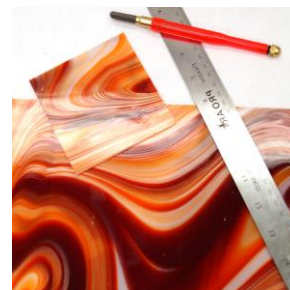

## Full Fuse Schedule:

Segment 1	300° per hour	1100° F	Hold 10 minutes
Segment 2	300° per hour	1250° F	Hold 30 minutes
Segment 3	300° per hour	1450° F	Hold 10 minutes
Segment 4	Full	960° F	Hold 30 minutes



3. Cut two 4" squares of 1/4" fiber paper and stack. Using a craft knife cut the center square out of the fiber paper.
4. Place stacked fiber paper onto kiln shelf lined with shelf paper.
5. Place glass blank square on top of fiber paper and fire using the slumping schedule provided.
6. Remove the finished product, clean and set in the recessed area of the upside down coaster holder.

### Slump Schedule:

Segment 1	300° per hour	1100° F	Hold 20 minutes
Segment 2	300° per hour	1290° F	Hold 30 minutes
Segment 4	Full	960° F	Hold 30 minutes

