

Ghost Luminary

Materials:

Semi-Transparent White Fusible Glass

1/32" Fiber Paper


Floral Fomer or other drape mold

Shelf Paper (Item #7405)

Black Glassline Pen (Item #802002)



Instructions:

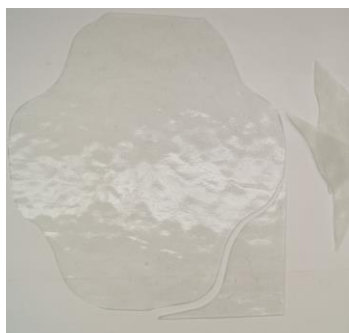


1. Instead of using a pattern we simply cut each to have an organic wavy edge.

2. Use Glassline pen to create your ghosts face on your bottom layer of glass- where you put the face depends on how tall your draping mold is. Allow Glassline to dry completely.



3. Place top layer of glass on top of bottom layer and fuse - we used a medium fuse to keep a bit of texture in the layers and slow ramp speed to make sure we didn't get big air pockets.

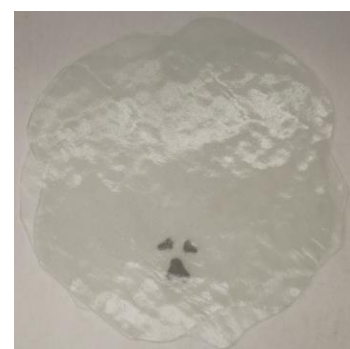


Firing Schedule

Segment 1	300° per hour	1100°F	Hold 10 minutes
Segment 2	200° per hour	1250° F	Hold 45 minutes
Segment 3	200° per hour	1375° F	Hold 30 minutes
Segment 4	Full	960° F	1 hour



4. On shelf paper, position your draping mold - we made our own using a shelf post, a ceramic candle cup and the CMS Floral & Foliage Mold Set (Item #24721).

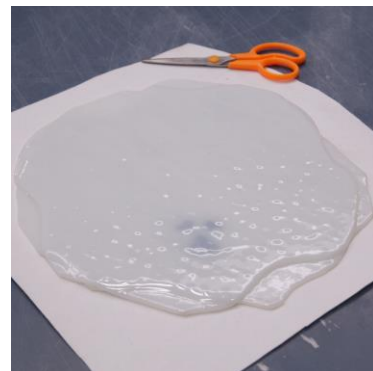

5. Balance fiber paper and glass blank on top of draping mold.



6. Fire using slumping schedule below.

7. Place a candle under your ghost and enjoy your spooky luminary all season!



Firing Schedule

Segment 1	300° per hour	1100°F	Hold 10 minutes
Segment 2	300° per hour	1325° F	Hold 15 minutes
Segment 4	Full	960° F	1 hour

